

N-Hance Process Sheets

Floor Renewal

1. Clean

- Sweep, vacuum, and clear area
- Use a 3M Maroon Buffer Pad (one side per ~250 sq. ft)
 - For floors with aluminum oxide finish, use Red & White Pad, or Black Pad
- Use a Surface Prep Pro solution made up of 12-16 parts water to 1 part Surface Prep Pro
- Clean first across the grain, then with the grain
- Remove slurry with cotton buffing pad before dry
- (Repeat steps if surface is still sticky or greasy)

2. Repair

- For worn areas:
 - If grey, apply Black Out followed up with Liquid Neutralizer
 - Perform a water test to determine if colour is needed
 - Apply N-Hance pigments or dyes as needed

3. Dry Tack (at least twice)

- Once dry, dry tack the floor using a blue microfiber pad; vacuum the pad as needed

4. Apply Sealer

- Apply a coat of Neutralizing Wood Sealer and allow to dry
 - If waiting longer than 4 hours to apply finish, lightly burnish the sealer on LOW speed with a grey abrasive pad over the white polishing pad.
 - Move quickly so you don't remove the sealer layer. The floor will look dull.
 - Dry tack at least twice with a blue micro-fiber pad, maintaining a leading edge.

5. Apply Finish

- Apply a coat of finish and allow to dry
- Apply a 2nd coat of finish, if desired
 - Non-UV-curing finishes must be burnished between coats if applied several hours apart
- Lightspeed Nano Floor can be used immediately after curing
- If another finish was used:
 - Stay off of the floor for 2-3 hours of dry time
 - Only stocking feet/socks for 24 hours, avoiding spinning/twisting motion
 - Bare feet may leave oil residue prior to 24 hours
 - Shoes may leave marks prior to 48 hours
 - Replace furniture after 72 hours
 - Replace area rugs after 1 week
 - All products, except for Lightspeed Nano, require TWO weeks to fully cure.